



YOSHIMURA

RESEARCH&DEVELOPMENT OF AMERICA, INC.

5420 DANIELS STREET STE A, CHINO CA., 91710 · (800)634-9166 · (909)628-4722 · FACSIMILE (909)591-2198

www.yoshimura-rd.com

Signature Series

Honda Rancher

324200C550


RS2 Full-System Exhaust



This product is 50-state legal and complies with Federal and State regulations. Any attempts to modify this product will render it non-compliant with Federal law and void warranty. If modified, the vehicle can no longer be used on public roads and can only be used for off-highway closed course competition. In the state of California, it is illegal to modify the emission control system, which includes the fuel injection system of any vehicle.



Assembly Diagram

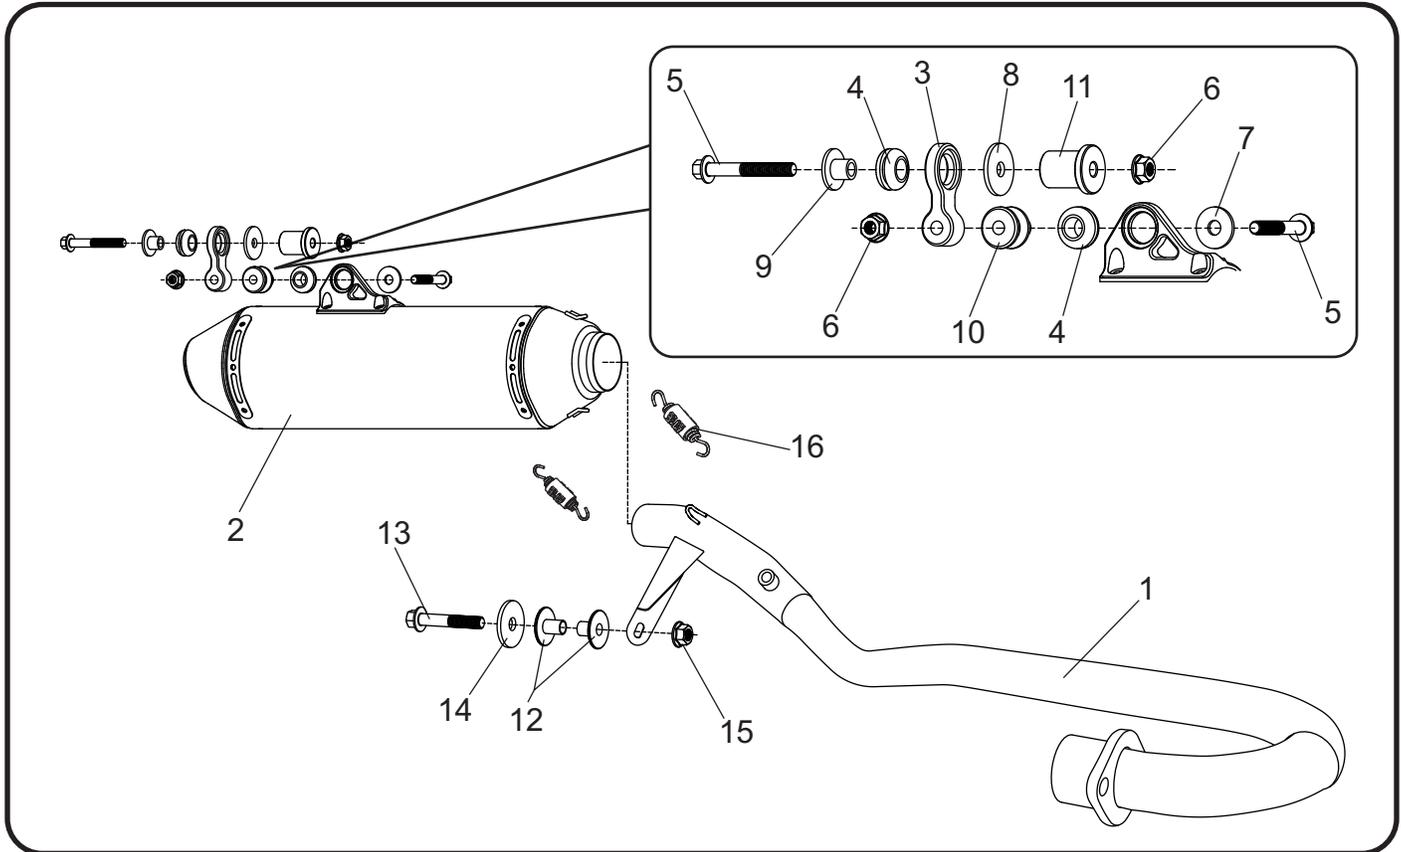

No.	Item	Description	Qty.
1	32420-101	Yoshimura Header	1
2	****	Signature Series Muffler	1
3	39900-RS4BRKT	Muffler Hanger Bracket	1
4	Z1022	Rubber Bushing	2
5	M8X60H	8mm x 60mm Flanged Hex Head Bolt	2
6	8MMNUT	8mm Flange Nut	2
7	8MMWASHERL	8mm Large Washer	1
8	8MMWASHERXL	8mm XL Washer	1
9	ALS-003	Aluminum Spacer	1
10	ALS-004	Aluminum Spacer	1
11	ALS-051	Aluminum Spacer	1
12	ALS-050	Aluminum Spacer	2
13	M10X60H	10mm x 60mm Flanged Hex Head Bolt	1
14	10X30WSH	10mm Washer	1
15	10MMFNUT	10mm Flange Nut	1
16	RACE-SPS-1	Medium Exhaust Spring	2
**	ST-200	Spring Puller Tool	1
**	347PLUG	Yoshimura Wash Plug	1
**	17029	Sticker Kit Sheet	1

**** Signature Series muffler replacement part number unavailable. Repair or replacement of Signature Series exhaust systems is only available directly through Yoshimura R&D of America, Inc.

Removal

1. Remove seat as per Factory Service / Owners Manual.
2. Remove the left side center splash guard by the footpeg. Take precaution when removing plastic push clips making sure not to damage them during the removal process.
3. Remove left side cover as per Factory Service / Owners Manual to gain access to the stock exhaust system.
4. Remove the O2 sensor from the stock muffler assembly.
5. Remove the stock header heatshield by removing the hose clamps securing heatshield to header.

Note: The stock header heatshield and hose clamps will be re-used with the Yoshimura exhaust system.

6. Remove the header nuts.
7. While securely supporting the stock muffler assembly, carefully remove muffler by sliding muffler pins out toward the front of the vehicle.


Note: Exhaust port gasket will be re-used with the Yoshimura exhaust system. Inspect and replace if necessary.

8. Remove the top rear muffler rubber bushing from the frame.


Note: The lower front muffler rubber bushing will be used. Do not remove.

Installation


1. Install (No. 12) ALS-050, aluminum spacer into the lower front muffler bushing as shown.

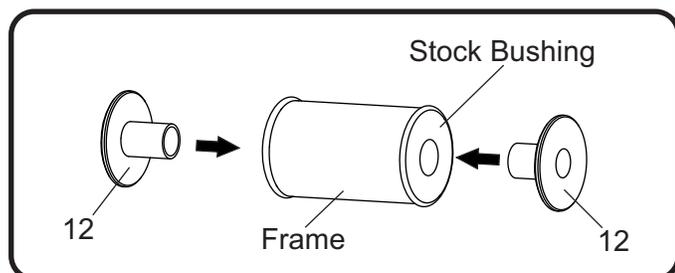


2. Install (No. 1) 32420-101, Yoshimura header using the stock header nuts. Do not torque at this time.
3. Align header chassis mount to frame and secure using (No. 13) M10X60H, 10mm bolt, (No. 14) 10X30WSH, 10mm washer, and (No. 15) 10MMFNUT, 10mm nut. See assembly diagram for proper orientation and order of hardware.
4. Install the stock O2 sensor into (No. 1) 32420-101, Yoshimura header. Torque to factory specification.
5. Install (No. 4) Z1022, rubber bushing into (No. 3) 39900-RS4BRKT, muffler hanger bracket.

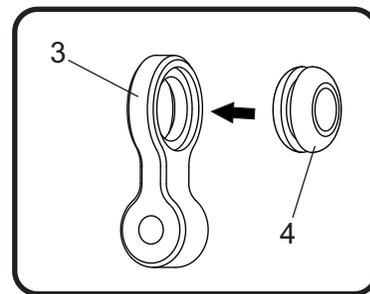


6. Install (No. 11) ALS-051, aluminum spacer into frame and secure using (No. 5) M8X60H, bolt, (No. 8) 8MMWASHERXL, XL washer, (No. 9) ALS-003, aluminum spacer, and (No. 6) 8MMNUT, flange nut as shown. Do not torque at this time.

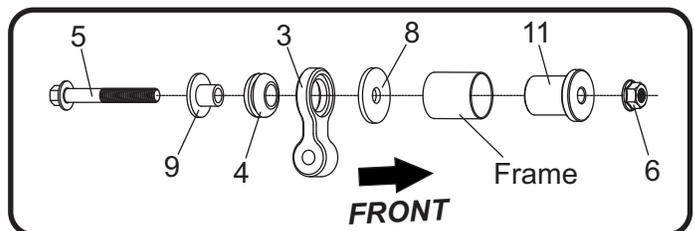


7. Install (No. 4) Z1022, rubber bushing into muffler bracket.

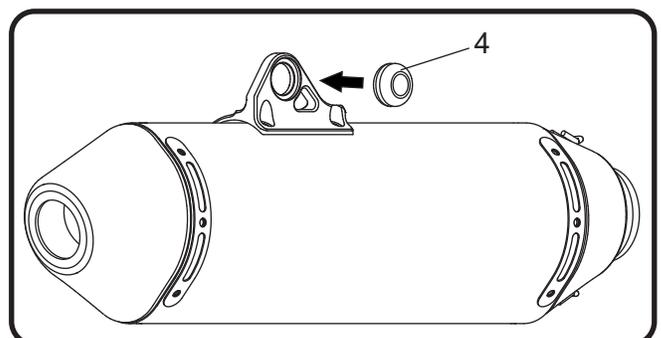

8. Install (No. 10) *ALS-004*, aluminum spacer into (No. 4) *Z1022*, rubber bushing in muffler bracket as shown.

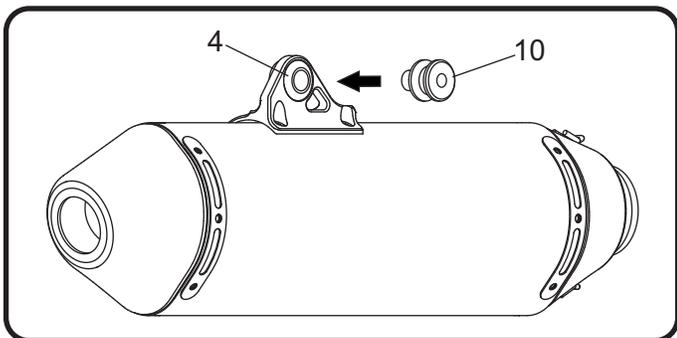

9. Install Yoshimura muffler assembly by sliding onto header outlet.
10. Secure Yoshimura muffler to (No. 3) *39900-RS4BRKT*, muffler hanger bracket using the provided (No. 5) *M8X60H*, bolt, (No. 7) *8MMWASHERL*, washer, and (No. 6) *8MMNUT*, nut.

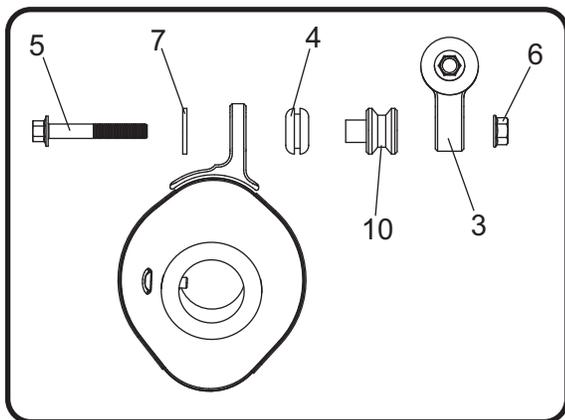

11. Install (No. 16) *RACE-SPS-1*, medium exhaust springs between muffler and header connection using the provided *ST-200*, spring puller tool.

12. Lift the header up and torque the header nuts to factory specification.

Note: Check to make sure there is ample clearance between the header and frame.

13. Torque (No. 5) *M8X60H*, muffler hanger bracket bolt and muffler mount bolt to 32.5 Nm (3.2 kg-m, 24 ft-lb).

14. Torque (No. 13) *M10X60H*, chassis mount bolt to 50 Nm (5.0 kg-m, 37 ft-lb).

15. Re-install the stock header heatshield onto (No. 1) *32420-101*, Yoshimura header using the stock hose clamps.

16. Before starting vehicle, check for proper clearance between new exhaust system and rear suspension (i.e. tire, control arms, brakes, rear shock, and etc.) If any problem is found, please carefully follow through the installation steps again. If problem still persists, please call Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722.

17. It is recommended that the muffler and tailpipe be wiped down with rubbing alcohol to remove oil and fingerprints. This will help prevent tarnishing of the finish after the exhaust is heated up.

Note: After starting motorcycle, it is normal for new exhaust system and muffler to emit smoke until oil residue burns off.

Dear Yoshimura Customer,

Congratulations and thank you for purchasing a Yoshimura Exhaust System. Over six decades of experience in research and development, state of the art machinery, materials and craftsmanship of the highest quality all come together in a product of exceptional quality and performance—in other words, this is the best thing you can put on your bike. We strive to provide you with a product perfect in fit and finish. However, if you have any problems, please give us a call. We have found that most fitment issues can be easily resolved by a conversation with one of our knowledgeable and friendly staff. If the issue cannot be resolved this way, our warranty evaluation program may be the answer. Please take a moment to review our recommendations for the care of your exhaust and our warranty information.

PLEASE NOTE: If you have any doubts about your exhaust: **DO NOT START THE MOTORCYCLE! ONCE AN EXHAUST HAS BEEN USED OR MODIFIED, IT CANNOT BE RETURNED FOR CREDIT OR EXCHANGE.**

EXHAUST SYSTEM MAINTENANCE

Yoshimura Exhaust Systems require very little care and maintenance; here are a few tips:

1. Use mild car/motorcycle soap to clean the exhaust system—do not use any abrasives or degreasers.
2. Clean your exhaust with metal/stainless polish every 1-2 months to retain the luster and remove dirt and grime. (DO NOT USE POLISH ON “WORKS FINISH” SYSTEMS)
3. Avoid contaminating exhaust surfaces when hot.
4. Your exhaust system will change color (blue, magenta, purple, and/or gold) due to heat; this is normal.
5. Keep all clamps, bolts and other fasteners tight as exhaust systems are susceptible to vibration damage.
6. If you ride in coastal regions or areas that use salt to control ice and snow, wipe the exhaust down after it cools to remove any possible salt residue, which can result in rusting.
7. If you are storing your motorcycle for the season, wipe the exhaust system down with rubbing alcohol before storage.
8. Head pipes glowing (visible in normal light) may indicate an excessively lean condition that must be corrected.

CARBON FIBER:

Carbon fiber equipped exhaust components require special attention. The following addresses wear issues directly related to carbon fiber:

1. Keep all clamps, bolts and other fasteners tight. Carbon Fiber is very susceptible to vibration damage.
2. Keep all chemicals and solvents away from the carbon fiber, as they will damage the finish.
3. High temperatures will cause the resin in the carbon fiber to break down. Visual signs such as an amber hue in the resin may be early signs of heat damage to carbon fiber.
4. Upon seeing amber colored resin, discontinue use. The exhaust system needs to be inspected by a representative from Yoshimura, for repack, and/or repair. Continued use will cause component failure.

STAINLESS STEEL:

Stainless Steel is not rust proof but is less prone to rusting, staining and pitting; but it is prone to oxidation like all metals.

WORKS FINISH:

1. Works Finish exhaust systems should never be cleaned with abrasives or polishes.
2. Yoshimura recommends using “Bar Keepers Friend” cleaner to remove minor stains.
3. Surface reconditioning services are available to remove scratches and undesirable discoloration due to extreme heat. Contact Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722 for more information.

RE-PACKING TIPS

To maintain maximum sound and engine performance the muffler packing will need to be replaced at some time during the muffler's life. Yoshimura recommends repacking your muffler at least once a year.

Failure to maintain the muffler packing may cause damage to the muffler and/or void the warranty. Regularly inspect the muffler body for discoloration, cracks, rattling, or other signs of wear caused by depleted muffler packing. If muffler packing is determined to be depleted or worn, a Yoshimura muffler re-pack kit is highly recommended to restore the muffler to optimum maximum performance.

Yoshimura offers a 3-5 day turn around (plus transit time) to inspect and refurbish used and damaged mufflers.

For more information on muffler repacking please visit our website at: <https://www.yoshimura-rd.com/pages/repack-and-insert-chart>

*****PRO TIP***** Before you install your new muffler for the first-time log the weight in your Owner's or Service manual along with the current hours or mileage on your vehicle. When you are performing periodic maintenance on your vehicle (like a tire change, or an oil change) you can remove your Yoshimura muffler from the vehicle and weigh it again. Over time, the packing material inside your muffler will burn off with use, and the muffler will need to be repacked. When the weight loses approximately 100 grams of the original weight, you should consider getting your Yoshimura muffler repacked. You can order repacking kit or the parts to repack the muffler from the Yoshimura website, or your local dealer. You can also contact the Yoshimura sales office and arrange to send in your muffler for the repacking service too.

IMPORTANT TECHNICAL NOTE

Yoshimura recommends on all race exhaust systems, that all spring joints be safety wired. Recommended wire type 304/316 stainless steel with a .032" diameter should be used.

YOSHIMURA EXHAUST LIMITED WARRANTY

All Yoshimura R&D of America, Inc., exhaust systems carry a one-year limited warranty against defects in workmanship and/or materials.

WHO IS COVERED?

This warranty is provided to the original purchaser of the exhaust system.

WHAT VOIDS THE WARRANTY?

1. Abuse, misuse, improper installation and/or modifications
2. Custom applications
3. No proof of purchase at the time of warranty. Claimant must provide proof of purchase (original receipt or invoice) and a warranty authorization number (RMA) obtained from Yoshimura.
4. Finishes such as plating or painted surfaces with discoloration or rust due to inclement weather conditions, exposure to salt, exposure to chemicals, or lack of maintenance by the customer are not covered.
5. International grey-market product purchased through a dealer/distributor not authorized for your country will not be supported by this warranty.

EXTENT OF WARRANTY:

Any defective exhaust system properly returned to Yoshimura will be repaired or replaced by Yoshimura. Yoshimura is not responsible for any other expense incurred by the customer under the terms of this limited warranty, nor is Yoshimura responsible for any damages either consequential, incidental, special, contingent or otherwise; or expenses or injury arising directly or indirectly from the use of the exhaust system. Any exhaust system returned to Yoshimura must be sent at the customer's expense along with the proof of purchase and warranty authorization (RMA). Yoshimura reserves the right to determine whether the terms of the warranty, set out above, have been properly followed. In the event that the terms are not followed this warranty is void. Yoshimura is the sole determiner of abuse, misuse,

installation errors and modifications—should any of these be found, this warranty is void. The duration of any and all implied warranties are limited to the duration of the express warranty. All incidental or consequential damages are hereby excluded. The warranty gives you specific legal rights and you may have other rights, which vary from state to state. Some states do not allow the exclusion or limitation of incidental or consequential damages or limitations on how long an implied warranty lasts, so the above limitations and exclusions may not apply to you.

If you have a fitment or other problem, or are missing a part, please double-check this trouble shooting guide first:

1. Reference your instruction sheet and double-check all drawings and instructions
2. Make sure muffler clamps are installed correctly (refer to instructions diagram). On many models, there is a right and wrong way to install. Also verify part numbers on headers and tail pipe.
3. Always make sure to install spring-mounted manifolds and flanges on cylinder head prior to installing headers.
4. Always take time to examine problems in detail.
5. When all else fails, call our technical support line at (909) 628-4722. The technical line is open 9:00am – 4:30pm Monday through Friday, Pacific Time. Please have the following information handy: Year/Make/Model of motorcycle, date of purchase, place of purchase, batch dates and part numbers (found on header and tail-pipe components).
6. Also, feel free to ask through online e-mail at sales@yoshimura-rd.com, or fax your question/problems to (909) 591-2198.

To obtain technical information directly from Yoshimura, call (909) 628-4722.