


## **YOSHIMURA**

RESEARCH&DEVELOPMENT OF AMERICA, INC.

5420 DANIELS STREET STE A, CHINO CA., 91710 · (800) 634-9166 · (909) 628-4722 · FAX (909) 591-2198

www.yoshimura-rd.com

## TURN SIGNAL ADAPTER PLATES Honda CB 1000 Hornet SP 073BG121500

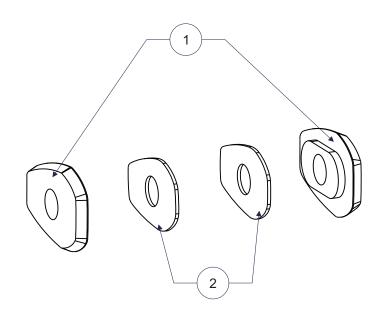

No.	Item	Description	Qty.
1	073BG121500-B	Front Turn Signal Plate	2
2	073BG121500-IN	Metal Inner Plate	2
Optional Accessories			
072BGLTSFK Yoshimura LED Front Turn Signal Kit			
072BGLTSFK-S Yoshimura Sequential LED Front Turn Signal Kit			

IMPORTANT: Installation of this product requires the use of aftermarket M8 mounted turn signals.

Not compatible with stock turn signals.

## Removal

- 1. Remove the meter cover (2 screws).
- 2. Remove the headlight cowls.




- 3. Remove the 2 bolts securing headlight assembly to the headlight stay.
- 4. Locate and disconnect the turn signal and headlight connectors.
- 5. Remove headlight assembly.

## Installation

 Install aftermarket turn signal and 073BG121500-B, front turn signal plate onto front side of turn signal holder. Install 073BG121500-IN, metal inner plate on backside of turn signal holder and secure using turn signal nut.

Rear of bike Front of bike

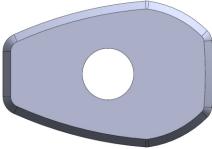

Right Side Example Shown

- 2. Repeat steps for the opposite side.
- 3. Reconnect turn signals.
- 4. Reinstall headlight assembly, cowls, and meter cover using the reverse steps of removal.
- 5. Check for proper function of turn signals and that all components are secure prior to riding. Adjust turn signal rotation as needed and tighten turn signal nut.