

YOSHIMURA

RESEARCH&DEVELOPMENT OF AMERICA, INC.

5420 DANIELS STREET STE A, CHINO CA 91710 · (800) 634-9166 · (909) 628-4722 · FAX (909) 591-2198

WWW.YOSHIMURA-RD.COM

Qualified Manufacturer Declared "Replacement Part"

ENDURO SERIES

**2020~2023
KTM
500 EXC-F**

**2020~2023
Husqvarna
FE 501S**

**2650005320 (SS/AL)
RS-12 Full-System Exhaust**



Enduro Series systems are:


- Equipped with USFS-approved spark arrestor.
- CARB/EPA tail-pipe emissions compliant.
- All applications are marked with appropriate EPA noise labels.
- Have not been tested for EPA new vehicle noise compliance.



❖ CAUTION: The muffler packing on this system **MUST** be replaced every 6-8 hours of use, or after each moto. Failure to follow recommended muffler re-packing interval can cause muffler damage and may void the warranty. ❖


NOTE: IN THE STATE OF CALIFORNIA, IT IS ILLEGAL TO MODIFY THE EMISSION CONTROL SYSTEM, WHICH INCLUDES THE CARBURETORS OF ANY VEHICLE.

Assembly Diagram

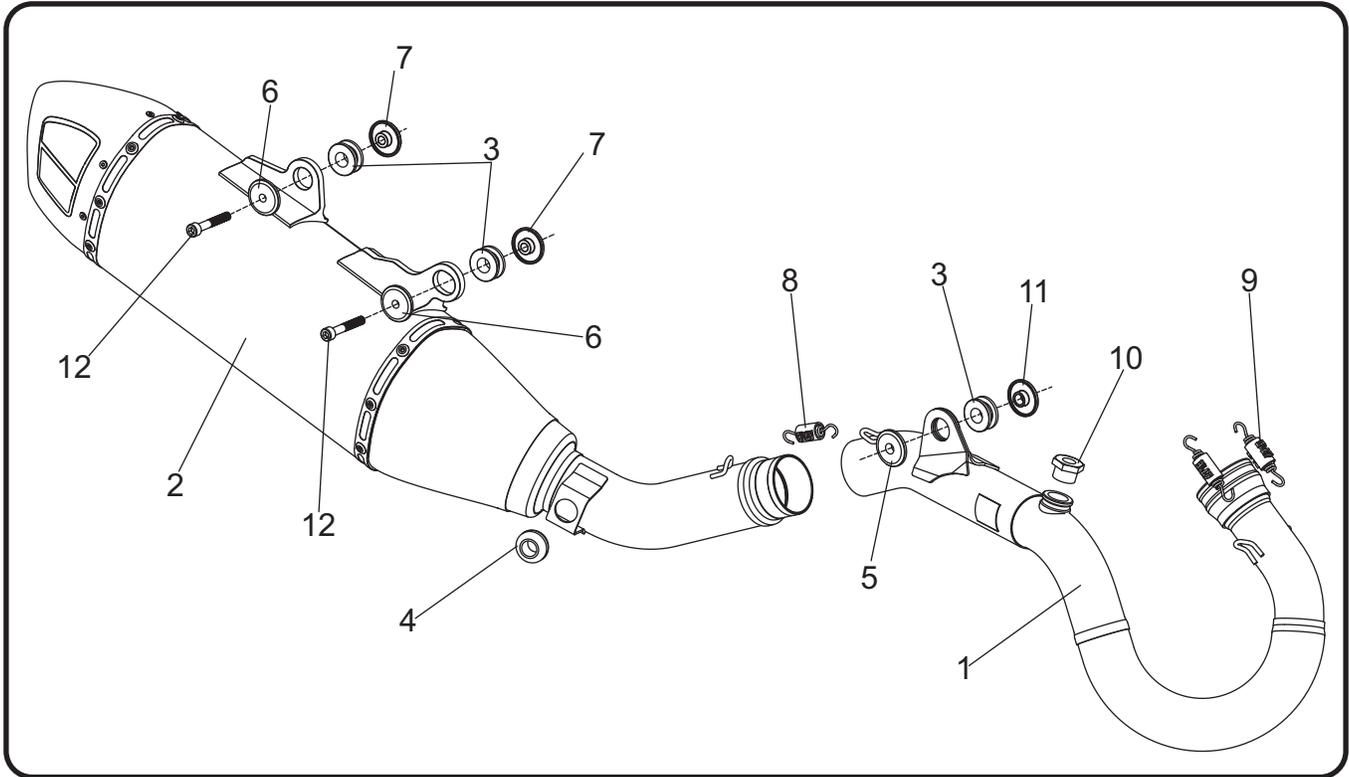


No.	Item	Description	Qty.
1	26500-104	Yoshimura SS Header	1
2	265000S320-RMA	Yoshimura Muffler Assembly	1
3	Z1024	Rubber Grommet (Square)	3
4	Z1022	Rubber Grommet	1
5	ALS-043	Aluminum Spacer, Front (8mm)	1
6	ALS-046	Aluminum Spacer, Front (6mm)	2
7	ALS-065	Aluminum Spacer, Back (6mm)	2
8	RACE-SPX-2	Short Exhaust Spring	1
9	RACE-SPS-1	Medium Exhaust Spring	2
10	OXYBA12X125SS	O2 Bung Adapter	1
11	ALS-066	Aluminum Spacer, Back (8mm)	1
12	M6X40	6mm x 40mm Socket Head Cap Bolt	2
**	ALFOILHS-8X10	Aluminum Heatshield Foil	1
**	INS-30-K	Low Volume Sound Insert (Installed)	1
**	S-1GM	Anti-Seize	1
**	ST-200	Spring Puller Tool	1
**	347PLUG	Wash Plug	1
**	17100	Sticker Sheet	1
OPTIONAL REPLACEMENT PARTS			
	SA-19-K	Spark Arrester Kit	

** Not shown on diagram.




Z1022



Z1024




ALS-043
(8mm)



ALS-066
(8mm)



ALS-046
(6mm)



ALS-065
(6mm)

CAUTION: Exhaust system can be extremely hot. Let motorcycle cool down before beginning installation. Always wear hand and eye protection and take precautionary measures to avoid injury.

WARNING: Always properly support vehicle with a stand and/or lift when servicing or performing any work. Unstable vehicles may present dangerous conditions and may cause property damage and/or personal injury.

NOTE: Read through all instructions before beginning installation.

Removal

NOTE: The OEM turn signals must be relocated as the exhaust gases from the muffler is in-line with the stock turn signal location.

1. Remove the stock exhaust spring between the muffler and tailpipe.
2. While securely supporting the stock muffler, remove the two muffler mount bolts and carefully remove the stock muffler.
3. Remove spring between header and tailpipe. Remove tailpipe chassis mount bolt and remove stock tailpipe.
4. Remove the O2 sensor from the stock header and remove header springs. Carefully remove the stock header.


For Husqvarna Only

Remove side panel as heatfoil needs to be applied on the backside of panel.


Remove wedge-shaped subframe heat protector as it will require trimming.

Installation


1. Install (No. 10) OXYBA12X125SS, O2 bung adapter into (No. 1) 26500-104, header.

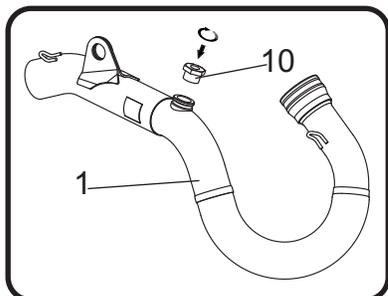


2. Install (No. 3) Z1024, square rubber grommet into header chassis mount bracket.

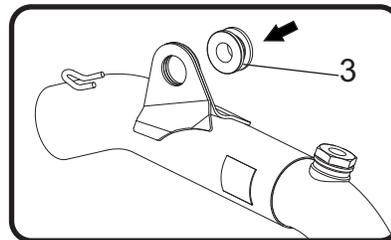


3. Install (No. 5) ALS-043, aluminum spacers (8mm hole) into frontside and (No. 11) ALS-066 into backside of (No. 3) Z1024, rubber grommet as shown. Install (No. 1) header and secure using (No. 9) RACE-SPS-1, medium exhaust springs and align header chassis mount bracket to chassis mount. Secure using the stock chassis mount bolt. Do not torque at this time.

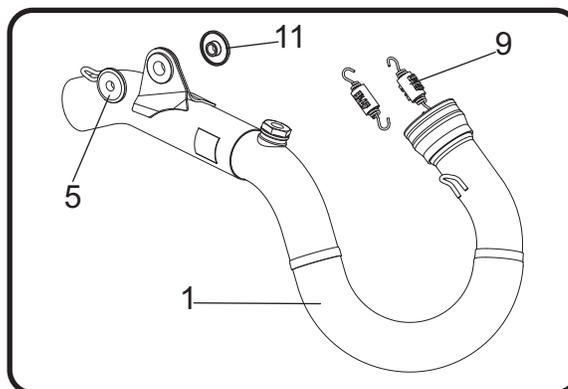


4. Install (No. 4) Z1022, round rubber grommet into muffler tailpipe bracket and install (No. 3) Z1024, square grommets into muffler mount brackets as shown.

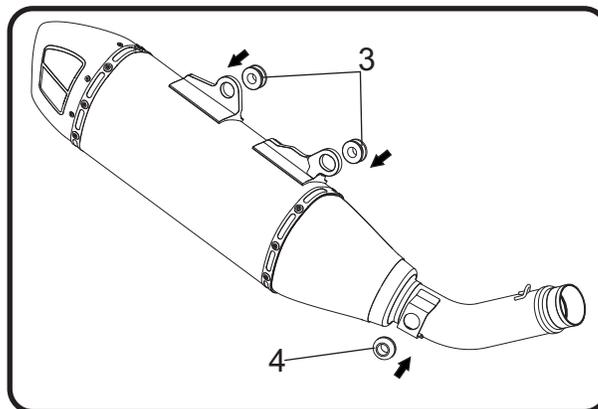

5. Install (No. 6) ALS-046, front aluminum spacers and (No. 7) ALS-065, back aluminum spacers into Z1024, rubber grommets as shown.

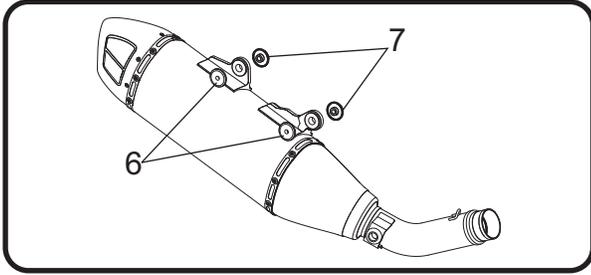

6. Apply supplied anti-seize inside muffer/tailpipe machined joint and spread evenly. Install (No. 2) 265000S320-RMA, muffer/tailpipe inlet onto (No. 1) 26500-104, header outlet and align muffer mount brackets to muffer mounts. Secure using supplied (No. 12) M6X40, 6mm bolts and install (No. 8) RACE-SPX-2, short exhaust spring as shown. Do not torque bolts at this time.

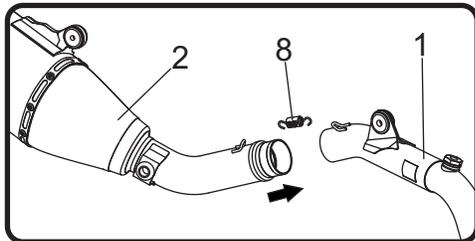

For Husqvarna Only

Using a marker and the upper rib as a guide, mark a straight line as shown below. Trim subframe heat protector using shears or a rotary tool.



Re-install subframe heat protector.

Cut out paper heatshield template and trace onto supplied heat foil and cut heat foil.

Clean the backside of side panel making sure it is free of debris and wipe dry.

Apply heat foil on side panel as shown.



Re-install side panel.

Note: Side panel bolt is not accessible with muffer installed.

7. Torque muffer mount bolts to factory specification.
8. Torque header chassis mount bolt to factory specification.
9. Re-install stock O2 sensor and torque to factory specification.
10. Before starting vehicle, check for proper clearance between new exhaust system and rear suspension (i.e. tire, swingarm, brakes, rear shock, and etc.) If any problem is found, please carefully follow through the installation steps again. If problem still persists, please call Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722.
11. It is recommended that the muffer and tailpipe be wiped down with rubbing alcohol to remove oil and fingerprints. This will help prevent tarnishing of the finish after the exhaust is heated up.


Note: After starting motorcycle, it is normal for new exhaust system and muffer to emit smoke until oil residue burns off.

Machined Joint Care & Maintenance

Clean and inspect machined joints when servicing the muffer during regular intervals.

Re-apply anti-seize on joints before re-installing exhaust system to maintain durability.

Husqvarna Heatshield Template

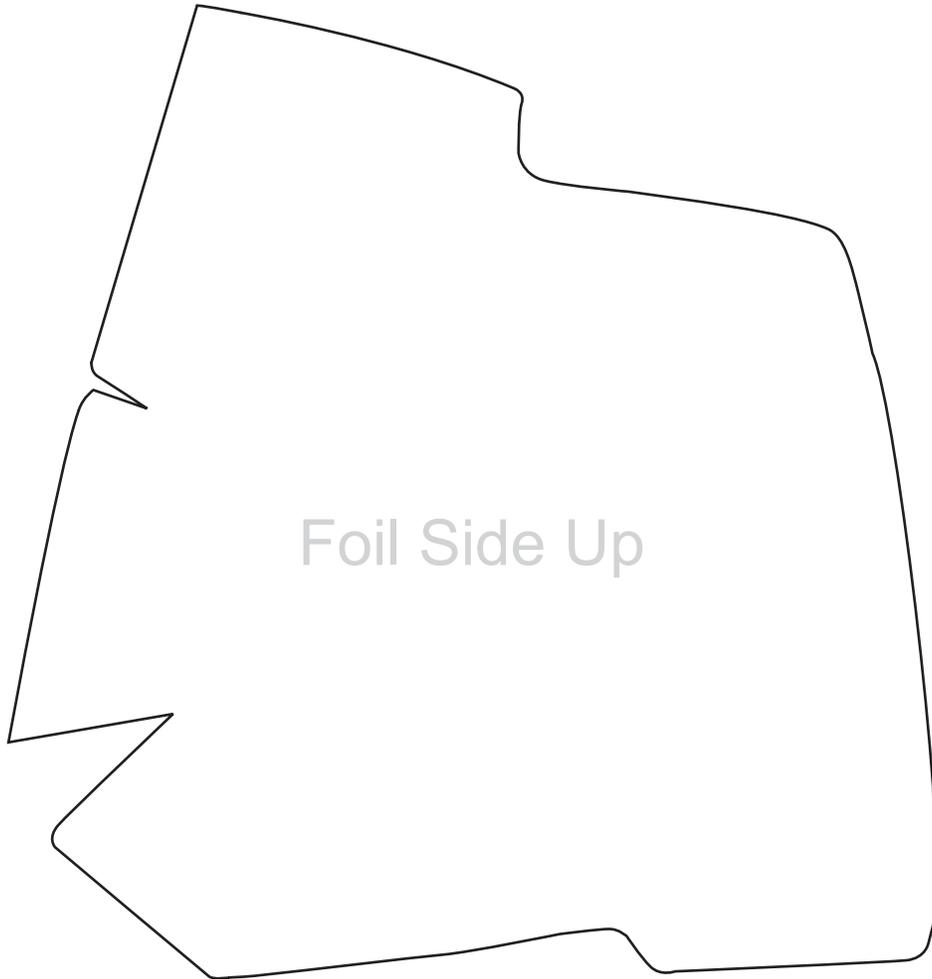

Be sure not to scale or resize when printing template.
Verify template is 1:1 using the scale below.



Dear Yoshimura Customer,

Congratulations and thank you for purchasing a Yoshimura Exhaust System. Over six decades of experience in research and development, state of the art machinery, materials and craftsmanship of the highest quality all come together in a product of exceptional quality and performance—in other words, this is the best thing you can put on your bike. We strive to provide you with a product perfect in fit and finish. However, if you have any problems, please give us a call. We have found that most fitment issues can be easily resolved by a conversation with one of our knowledgeable and friendly staff. If the issue cannot be resolved this way, our warranty evaluation program may be the answer. Please take a moment to review our recommendations for the care of your exhaust and our warranty information.

PLEASE NOTE: If you have any doubts about your exhaust: **DO NOT START THE MOTORCYCLE! ONCE AN EXHAUST HAS BEEN USED OR MODIFIED, IT CANNOT BE RETURNED FOR CREDIT OR EXCHANGE.**

EXHAUST SYSTEM MAINTENANCE

Yoshimura Exhaust Systems require very little care and maintenance; here are a few tips:

1. Use mild car/motorcycle soap to clean the exhaust system—do not use any abrasives or degreasers.
2. Clean your exhaust with metal/stainless polish every 1-2 months to retain the luster and remove dirt and grime. (DO NOT USE POLISH ON “WORKS FINISH” SYSTEMS)
3. Avoid contaminating exhaust surfaces when hot.
4. Your exhaust system will change color (blue, magenta, purple, and/or gold) due to heat; this is normal.
5. Keep all clamps, bolts and other fasteners tight as exhaust systems are susceptible to vibration damage.
6. If you ride in coastal regions or areas that use salt to control ice and snow, wipe the exhaust down after it cools to remove any possible salt residue, which can result in rusting.
7. If you are storing your motorcycle for the season, wipe the exhaust system down with rubbing alcohol before storage.
8. Head pipes glowing (visible in normal light) may indicate an excessively lean condition that must be corrected.

CARBON FIBER:

Carbon fiber equipped exhaust components require special attention. The following addresses wear issues directly related to carbon fiber:

1. Keep all clamps, bolts and other fasteners tight. Carbon Fiber is very susceptible to vibration damage.
2. Keep all chemicals and solvents away from the carbon fiber, as they will damage the finish.
3. High temperatures will cause the resin in the carbon fiber to break down. Visual signs such as an amber hue in the resin may be early signs of heat damage to carbon fiber.
4. Upon seeing amber colored resin, discontinue use. The exhaust system needs to be inspected by a representative from Yoshimura, for repack, and/or repair. Continued use will cause component failure.

STAINLESS STEEL:

Stainless Steel is not rust proof but is less prone to rusting, staining and pitting; but it is prone to oxidation like all metals.

WORKS FINISH:

1. Works Finish exhaust systems should never be cleaned with abrasives or polishes.
2. Yoshimura recommends using “Bar Keepers Friend” cleaner to remove minor stains.
3. Surface reconditioning services are available to remove scratches and undesirable discoloration due to extreme heat. Contact Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722 for more information.

RE-PACKING TIPS

To maintain maximum sound and engine performance the muffler packing will need to be replaced at some time during the muffler's life. Yoshimura recommends repacking your muffler at least once a year.

Failure to maintain the muffler packing may cause damage to the muffler and/or void the warranty. Regularly inspect the muffler body for discoloration, cracks, rattling, or other signs of wear caused by depleted muffler packing. If muffler packing is determined to be depleted or worn, a Yoshimura muffler re-pack kit is highly recommended to restore the muffler to optimum maximum performance.

Yoshimura offers a 3-5 day turn around (plus transit time) to inspect and refurbish used and damaged mufflers.

For more information on muffler repacking please visit our website at: <https://www.yoshimura-rd.com/pages/repack-and-insert-chart>

*****PRO TIP***** Before you install your new muffler for the first-time log the weight in your Owner's or Service manual along with the current hours or mileage on your vehicle. When you are performing periodic maintenance on your vehicle (like a tire change, or an oil change) you can remove your Yoshimura muffler from the vehicle and weigh it again. Over time, the packing material inside your muffler will burn off with use, and the muffler will need to be repacked. When the weight loses approximately 100 grams of the original weight, you should consider getting your Yoshimura muffler repacked. You can order repacking kit or the parts to repack the muffler from the Yoshimura website, or your local dealer. You can also contact the Yoshimura sales office and arrange to send in your muffler for the repacking service too.

IMPORTANT TECHNICAL NOTE

Yoshimura recommends on all race exhaust systems, that all spring joints be safety wired. Recommended wire type 304/316 stainless steel with a .032" diameter should be used.

YOSHIMURA EXHAUST LIMITED WARRANTY

All Yoshimura R&D of America, Inc., exhaust systems carry a one-year limited warranty against defects in workmanship and/or materials.

WHO IS COVERED?

This warranty is provided to the original purchaser of the exhaust system.

WHAT VOIDS THE WARRANTY?

1. Abuse, misuse, improper installation and/or modifications
2. Custom applications
3. No proof of purchase at the time of warranty. Claimant must provide proof of purchase (original receipt or invoice) and a warranty authorization number (RMA) obtained from Yoshimura.
4. Finishes such as plating or painted surfaces with discoloration or rust due to inclement weather conditions, exposure to salt, exposure to chemicals, or lack of maintenance by the customer are not covered.
5. International grey-market product purchased through a dealer/distributor not authorized for your country will not be supported by this warranty.

EXTENT OF WARRANTY:

Any defective exhaust system properly returned to Yoshimura will be repaired or replaced by Yoshimura. Yoshimura is not responsible for any other expense incurred by the customer under the terms of this limited warranty, nor is Yoshimura responsible for any damages either consequential, incidental, special, contingent or otherwise; or expenses or injury arising directly or indirectly from the use of the exhaust system. Any exhaust system returned to Yoshimura must be sent at the customer's expense along with the proof of purchase and warranty authorization (RMA). Yoshimura reserves the right to determine whether the terms of the warranty, set out above, have been properly followed. In the event that the terms are not followed this warranty is void. Yoshimura is the sole determiner of abuse, misuse,

installation errors and modifications—should any of these be found, this warranty is void. The duration of any and all implied warranties are limited to the duration of the express warranty. All incidental or consequential damages are hereby excluded. The warranty gives you specific legal rights and you may have other rights, which vary from state to state. Some states do not allow the exclusion or limitation of incidental or consequential damages or limitations on how long an implied warranty lasts, so the above limitations and exclusions may not apply to you.

If you have a fitment or other problem, or are missing a part, please double-check this trouble shooting guide first:

1. Reference your instruction sheet and double-check all drawings and instructions
2. Make sure muffler clamps are installed correctly (refer to instructions diagram). On many models, there is a right and wrong way to install. Also verify part numbers on headers and tail pipe.
3. Always make sure to install spring-mounted manifolds and flanges on cylinder head prior to installing headers.
4. Always take time to examine problems in detail.
5. When all else fails, call our technical support line at (909) 628-4722. The technical line is open 9:00am – 4:30pm Monday through Friday, Pacific Time. Please have the following information handy: Year/Make/Model of motorcycle, date of purchase, place of purchase, batch dates and part numbers (found on header and tail-pipe components).
6. Also, feel free to ask through online e-mail at sales@yoshimura-rd.com, or fax your question/problems to (909) 591-2198.

To obtain technical information directly from Yoshimura, call (909) 628-4722.